TESTDRIVETECH VEHICLE INSPECTION SOLUTIONS . COM

Estimation

№ E-002-00213

Test Drive Technologies 17715 St Rose Rd St Rose, IL 62230 Tel: 636-388-8378 steve@testdrivetech.com

http://www.testdrivetech.com

Name: Removed For Privacy Protection

Address: 17715 St Rose Rd, St Rose, IL 62230

Date: 7/7/2017 9:26 AM

Make: BMW

Model: 3 Series

Year: 2008

Color: Silver / Gray

Mileage: 173005

Tag #:


R.O. #:

VIN #: WBAVB73568VF51144

Stock #:

Advisor:

Customer's Signature

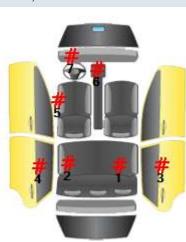



Wheels

LF RF

☐ LR ☐ RR

Legend		
×	EXTERIOR ISSUE	
₩	TIRE REPLACEMENT	
*	MECHANICAL ISSUE	
#	INTERIOR ISSUE	
≋	PAINT MEASUREMENT	
30	TROUBLESHOOT ISSUE	
₩	WHEEL DAMAGE	

#	Service	Amount
01	INTERIOR ISSUE	\$0.00
L	WEAR - RR SEAT	
02	INTERIOR ISSUE	\$0.00
	WEAR - LR SEAT	
03	INTERIOR ISSUE	\$0.00
	WEAR - RR DOOR PANEL	
04	INTERIOR ISSUE	\$0.00
	WEAR - LR DOOR PANEL	
05	INTERIOR ISSUE	\$0.00
	WEAR - LF SEAT	
06	INTERIOR ISSUE	\$0.00
	BROKEN TRIM - ASH TRAY DOOR	
07	INTERIOR ISSUE	\$0.00

	WEAR - STEERING WHEEL	
08	EXTERIOR ISSUE	\$0.00
00	CHIPS - FRONT BUMPER	φυ.υυ
	EXTERIOR ISSUE	# 0.00
09		\$0.00
	CHIPS - HOOD	фо oc
10	EXTERIOR ISSUE	\$0.00
	CHIPS - RF FENDER	
11	EXTERIOR ISSUE	\$0.00
	CHIPS - LF FENDER	
12	WHEEL / RIM REPAIR	\$0.00
	CURB RASH - LF WHEEL	
13	WHEEL / RIM REPAIR	\$0.00
	CURB RASH - LR WHEEL	
14	WHEEL / RIM REPAIR	\$0.00
	CURB RASH - RR WHEEL	
15	WHEEL / RIM REPAIR	\$0.00
	CURB RASH - RF WHEEL	
16	REPLACE TIRE	\$0.00
	REPLACE TIRE - LR TIRE LOW ON TREAD	40.00
17	REPLACE TIRE	\$0.00
	REPLACE TIRE - RR TIRE LOW ON TREAD	
18	MECHANICAL ISSUE	\$0.00
	ALIGNMENT NEEDED - UNEVEN FRONT TIRE WEAR	
19	MECHANICAL ISSUE	\$0.00
	OIL LEAK - ENGINE VALVE COVER	
20	EXTERIOR ISSUE	\$0.00
	CHIPS - FRONT GLASS	
21	PAINT MEASUREMENT	\$0.00
	PREVIOUS PAINT - RF FENDER	A 2 25
22	PAINT MEASUREMENT	\$0.00
	PREVIOUS PAINT - LF FENDER	
23	PAINT MEASUREMENT	\$0.00
24	PAINT MEASUREMENT	\$0.00
	PREVIOUS PAINT - LF DOOR	
25	PAINT MEASUREMENT	\$0.00
	PREVIOUS PAINT - LR DOOR	
26	PAINT MEASUREMENT	\$0.00
	PREVIOUS PAINT - LR QUARTER PANEL	
27	PAINT MEASUREMENT	\$0.00
	PREVIOUS PAINT - TRUNK LID	
28	PAINT MEASUREMENT	\$0.00
	PREVIOUS PAINT - REAR BUMPER	фо oo
29	PAINT MEASUREMENT	\$0.00
	PREVIOUS PAINT - RR QUARTER PANEL	фо ос
30	PAINT MEASUREMENT	\$0.00
	PREVIOUS PAINT - RR DOOR	# 0.00
31	PAINT MEASUREMENT	\$0.00
	PREVIOUS PAINT - RF DOOR	#0.00
32	PAINT MEASUREMENT PREVIOUS PAINT - FRONT BUMPER	\$0.00
20		# 0.00
33	PAINT MEASUREMENT	\$0.00
	PREVIOUS PAINT - ROOF PANEL	фо оо
34	TROUBLESHOOT ISSUE	\$0.00
	TROUBLESHOOTING REQUIRED - SUNROOF CABLE ALIGNMENT NEEDED (ABNORMAL NOISE FROM MOTOR)	-
	HOIGE I HOW MOTOTY	

35 MECHANICAL ISSUE \$0.00
TROUBLESHOOTING NEEDED - "BRAKE LAMP" ILLUMINATED WITHOUT PARKING BRAKE OR BRAKES APPLIED
Total: \$0.00